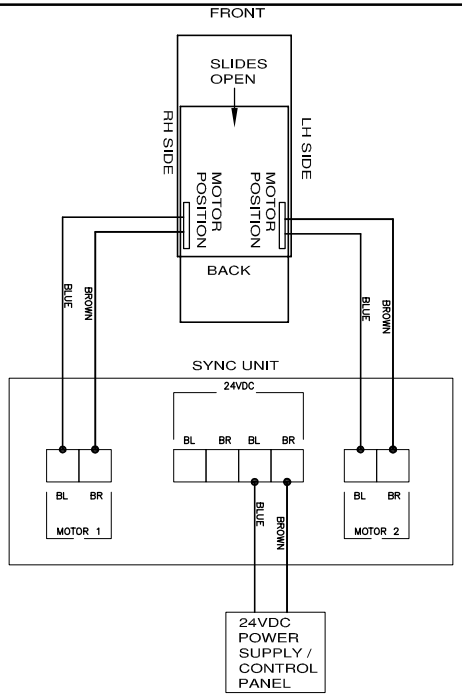

ACTUATOR SYNC UNIT WIRED AS ABOVE

FOR TANDEM ACTUATOR MOVEMENT:
"CN4 2" SET TO RIGHT
"CN4 1" SET TO LEFT

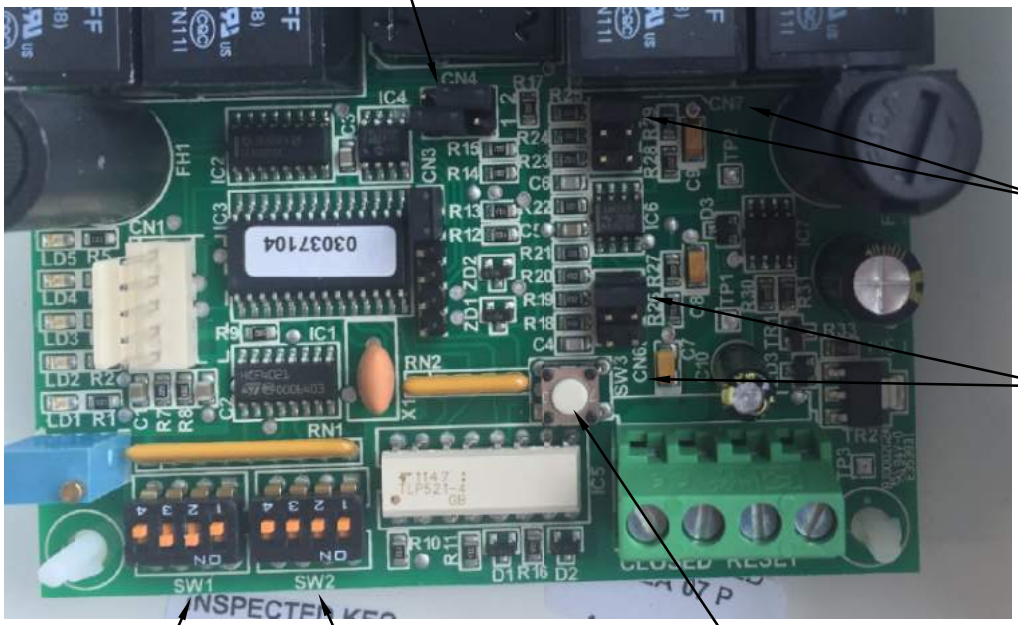

CN7 SET TO RIGHT/TOP

CN6 SET TO RIGHT/TOP

SW1 SET TO:
1 = OFF
2 = ON
3 = ON
4 = OFF

SW2 SET TO:
1 = OFF
2 = OFF
3 = OFF
4 = OFF

IF ACTUATORS ARE NOT WORKING SYNC UNIT MAY NEED RESETTING, PRESS AND RELEASE WHILST THE UNIT IS POWERED TO CLEAR ANY ERRORS THAT HAVE BEEN DETECTED, NOTE THE ACTUATORSD WILL STILL NOT MOVE UNTIL THE INCOMING POWER HAS BEEN CYCLED OFF THEN BACK ON.

NOTE
IF THE ACTUATORS ARE CUTTING OUT TOO EARLY CHANGE THE SETTINGS OF SW1 TO:
1 = OFF
2 = ON
3 = ON
4 = ON

DUPLUS SHOP CODE :

Rev	Date	Description	Rev By
B	19/05/16	RE-SET PROCEDURE ADDED.	I.W.
A		FIRST ISSUE	

THIS DRAWING REMAINS THE COPYRIGHT OF DUPLUS ARCHITECTURAL SYSTEMS LTD. AND MUST NOT BE REPRODUCED WITHOUT PRIOR AUTHORIZATION.

370 Melton Road,
Leicester
LE4 7SL
Tel: 0116 2610710
Fax: 0116 2610539

DUPLUS

DUPLUS WORKS–EACH MANUFACTURED COMPONENT ± 1 mm SITE INSTALLED COMPOSITE FRAMES ± 10 mm

Scale: N.T.S.
Drawn:
Contract: SB ROOFLIGHTS
Title: SLIDING ROOFLIGHT SYNC UNIT
Job No:
Drg No: SB014 – REV –A